

# Manhole Inspection Summary

Manhole # S07QQ1023MH

Printed On: 1/14/2009

Page 1 of 3

**Inspection** ☐ Is Incomplete Rating: **2) Good**

Record Plat: **07QQ1** Node: **023** Status: **Found**

Insp Date: **7/9/08 8:47 AM**

Incomplete Comments

Crew: **ADS2**  
Inspector: **ADS3**  
Firm: **ADS**

**Location** Address: **5272 PARK HEIGHTS AVE** Cross Street: **HAYWARD AVE**

**Manhole** Type: **Terminal** Location: **Sidewalk** Ground Conditions: **Dry**  
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **25.** (in.) Length: (in.) Dist A/B Grade: **0** (in.)  
**75**

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **8** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **42** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Bench** ☐ Exists Material: ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Steps** Count: **2** Missing: **0** ☒ **Corroded**

**Surcharge** ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present


Location View



Top View



Top View

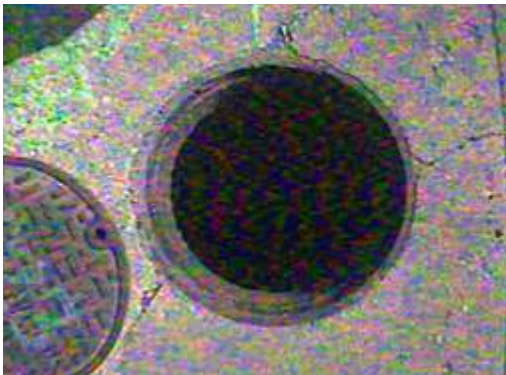

Defect 3



LOOSE BRICKS, DETERIORATION OF CHIMNEY

Defect 1



INFILTRATION OF CORBEL WALL

## Manhole Inspection Summary

Manhole # S07QQ1023MH

Printed On: 1/14/2009

Page 3 of 3

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.00** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **8** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection